t.s.s. MAXI GORKIY

Statement of Corrective Action for the Deficiencies detained in Vessel Sanitation Inspection Report

Inspection Date: 17/04/2002 Port of Inspection: New York

Next vessel's call to U.S. port: Los Angeles; 02/02/2003

	Detai	Is of Inspect					
No.	Location	Description (Extract from Summery)	Details of Inspection Violations			Critical	Vessel's Corrective Action Due dates of rectification
1	2	3	4	5	6	7	8
1	Deck 4 Galley	Decks/bulkheads/deckheads construction, repair, clean	Several small screw holes were present in bulkhead along one corner of the hot galley, all the holes were immediately filled with sealant	33	1	No	All screw holes were filled with sealant prior the completion of inspection The matter is closed
2	Deck 4 Galley - Cold Pantry	Nonfood-contact surface designed, constructed, maintained, installed, located	A few small screw holes were noted on the shelves of the undercounter neutral cabinets	21	0	No	All screw holes were filled with sealant next day after inspection. The matter is closed
3	Deck 4 Galley	Equipment/utensils non-food- contact surface clean	The top rim of the 2 ice maker covers inside the upper technical compartment of the ice machine were soiled with mold residue.	27	0		The procedure of top rim's cleaning on weekly basis is implemented. The persons in charge are instructed accordingly. The matter is closed
4	Deck 4 Galley	Food-contact surface equipment/utensils clean; Safe	A few of the large wine dispenser nozzles were soiled with wine residue	26	0	Yes	The procedure of nozzles' washing with chlorine solution (immediately after use) is implemented. The persons in charge are instructed accordingly. The matter is closed
5	Deck 4 Galley - Pastry	PHF temperature maintenance facilities; Food-contact surface designed,constructed,installed maintained; TMD=s	All the stone shelves inside the two stacked ovens were broken and cracked severely, making them difficult to clean	20	2		This deficiency may not be rectified whilst vessel's being in operation (with PAX onboard) as no repair work is permitted simultaneously with cooking processes at Galleys' areas. The item is included to Work Specification of Drydocking/2002 Due date: 30/11/2002
6	Deck 5 Galley Pastry	Plumbing fixture/supply/drain lines/drain installed,repair	Sea water was slowing leaking from a fire system pipe.	34	1	No	The leaking Fire System pipe was repaired on 19/04/2002. The matter is closed
7	Deck 5 Corridor Near Pastry	Food protected storage, preparation, display, service, transportation; Original containers, labeling; Food handling minimized.	Various food items such as packaged bread ice cream and dry foods in bins were stored near an outer door where other mechanical equipment was located. Seawater was dripping from a leaking fire line to the	19	0	No	All deficiencies were rectified on 19/04/2002

			bulkhead just above a covered bin of flour.				The matter is closed
8	Near Pastry	PHF temperature maintenance facilities; Food-contact surface designed,constructed,installed maintained; TMD=s	The ice cream chest freezer in use not designed according to criteria established by the American National Standards Institute or equivalent. In addition, the exterior front and side panels were severely damaged, as was the two top sliding doors. The interior surfaces were heavily frosted ice cdystals, making them difficult to clean properly.	20	2	No	The obsolete ice cream freezer will be renewed. The Purchase Order re the matter is generated. Due date: 02/06/2002
9		Decks/bulkheads/deckheads construction, repair, clean	The deckhead was unfinished and difficult to clean due to overhead piping, wiring, switches and other such features.	33	1	No	This deficiency may not be rectified whilst vessel's being in operation (with PAX onboard) as no repair work is permitted simultaneously with food handling at Provision store-rooms. The item is included to Work Specification of Drydocking/2002 Due date: 30/11/2002
10	Butcher Pre-	Equipment/utensils/linen/ single/service storage,handling dispensed; Clean frequency	Clean cutting knives were not stored in this space and were not stored protected. Install a proper knife locker or other locked cabinet for sanitary storage of knives.	28	0	No	A proper stainless steel locker has been installed by crew. The matter is closed
11		Food source, sound condition; food not re-served	An unopened box of raw lettuce had spoiled heads inside. These vegetables were provisioned at least 10 days ago. Ensure that fresh fruit &vegetable boxes are inspected sooner. So,that spoiled items are removed and don't spoil entire box of food.	15	0	Yes	The procedure of vegetables' handling and provisioning is improved. Provision Master is instructed accordingly The matter is closed
12	Service General	PHF temperature maintenance facilities; Food-contact surfaces designed, constructed,installed maintained; TMD=s provided, located, calibrated	Interiors of reach-in refrigerators were difficult to clean due to exposed fan units, wiring and piping sections	20	0	No	This deficiency may not be rectified whilst vessel's being in operation (with PAX onboard) as no renewal of old equipment is permitted simultaneously with food handling and provisioning at food service areas. The item is included to Work Specification of Drydocking/2002 Due date: 30/11/2002
13	Service	Temperature practices storage, preparation display, service, transportation. Thawing	Raw salmon is used for making gravlax, but there is no record that the fish was either frozen onbord or frozen by the supplier to safe temperature and time	17	0	No	The record procedure is implemented. F & B Manager is instructed accordingly The matter is closed
14	Service	Unnecessary articles, cleaning equipment; Unauthorised personnel	Numerous equipment such as ovens,ranges grills, reach-in refrigerators, ice machines, warewash machines,and other such units were posted out of order in various galleys, pantries, lido and bars. This equipment	38	1	No	This deficiency may not be rectified whilst vessel's being in operation (with PAX onboard) as no renewal of old equipment is permitted simultaneously with food handling and provisioning at food service areas.

			should be evaluated and needed items repaired or replaced. Those not needed items should be removed.				The item is included to Work Specification of Drydocking/2002 Due date: 30/11/2002
15	Neptune Bar	Equipment/utensils/linen/ single/service storage,handling dispensed; Clean frequency	The handwash sink basin is on the same counter and directly besides the utility sink in the front bar, with no shield preventing contamination of the utility sink	28	0	No	This deficiency may not be rectified whilst vessel's being in operation (with PAX onboard) as no repair work is permitted simultaneously with PAX servicing process. The item is included to Work Specification of Drydocking/2002 Due date: 30/11/2002
16	Portable Water - Fire Distribution Statio	PW filling hoses, caps, connections,procedures;Sample records, valves; PW system constructed, maintained	The current backflow preventer on the international connection is not adequate. These backflow preventers were located in the port and starboard fire distribution manifold stations.	08	0	No	Description of USPH approved type of preventor is received by e-mail. The matter is under consideration Due date: 30/09/2002
17	Portable Water	PW filling hoses, caps, connections,procedures;Sample records, valves; PW system constructed, maintained	A halogen demand and PH test was not being conducted prior to bunkering	08	0	No	The procedures of halogen demanding and PH prior to bunkering are implemented The persons in charge are instructed accordingly. The matters are closed
18	Swimming Pools	Swimming pools/spas maintained, safety equipment	Deapth markers were not prominently displayed so they could be seen from the deck and from the pool	10	0	No	Rectification is in progress Due date: 01/06/2002
19	Corrective Action Statement	Miscellaneous	aa. Critical-Item deficiencies bb.Way of forwarding of C/A Statement cc. Subject of message	*	0	No	All instructions re aacc.are well noted and taken for further guidance.
20	Portable Water	PW filling hoses, caps, connections,procedures;Sample records, valves; PW system constructed, maintained	One of the backflow preventers was weeping in the ddeck 6 PAX laundry room. This was corrected during inspection.	08	0	No	The item was closed prior to inspection's completion The matter is closed
21	Medical	Medical logs maintained	The current gastrointestinal illness surveillance log did not have all the data elements as specified in the 2000 VSP Operational Manual. A food questionnaire should also be put into place as part of the food history investigation.	02	0	No	The procedure has been implemented The matter is closed